

Date: Wednesday, 5/2/2007 3:45:39 PM
 User: Ken Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 206L FWD X-TUBE
Job Number	: 32141		
Estimate Number	: 10553		
P.O. Number	: <u>N/A</u>	Part Number	: D206667103
This Issue	: 5/2/2007	S.O. No.	: <u>N/A</u>
Prsht Rev.	: NC	Drawing Number	: D206-667-143 REV B
First Issue	: <u>N/A</u>	Project Number	: N/A
Previous Run	: 32140	Drawing Revision	: B
		Material	: <u>N/A</u>
Written By	: <u>[Signature]</u>	Due Date	: 5/30/2007
Checked & Approved By	: <u>[Signature]</u>	Qty:	1 Um: Each
Comment	: Est Rev: F 05.09.01 Add holes for compatibility with Bell Skidtubes KJ/JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description:
---------	-----------------------	--------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



KS 07.05.10 ①

Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D206-667-103 CHG002

En 07/09/05 ~~07/05/05~~

2.0	D6002115	Crosstube material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6002-115 Crosstube 329113

Check OD = 2.250"; ID = 1.750"

JS 07/05/15

3.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

Q10 ②

JS 07/05/15

4.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------






 
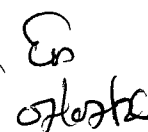
Comment: INSPECT ALL DIM TO DIM SHEET

JS 07/05/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07/05/15	3.0	The length of the tube is short from .010"	 07.05.17	THIS DEVIATION IS ACCEPTABLE AS LONG AS BOTH CUFFS ARE REDUCED IN LENGTH BY 0.005"	 07/05/15	 07/05/15	 07.05.17	 07/05/15

NOTE: Date & initial all entries

Date: Wednesday, 5/2/2007 3:45:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 32141

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA087

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-143

Inside of Cuff(Donot engrave on outside of tube)

88 07/07/25

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

88 07/07/25

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

Er 07/07/26 (x1)

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Polish entire outside surface of crosstube

JD 7-7-26

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 07/07/26 (x1)

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JD 7-7-26

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D206-667-143 using CNC bender program 206L-fw and Folio FT017

EL 7-8-17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 5/2/2007 3:45:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 32141

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

in 07/08/21

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143

6-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D206-667-143.

8-C'sink holes as per Dwg D206-667-143. Allow rivet to sit below surface to compensate for paint.

9-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143

070

JD 78

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JD 7-82

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

207-08-290

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

207-08-290

CHANGES

W/O:

WORK ORDER CHANGES

DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 5/2/2007 3:45:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 32141

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

OUTSIDE SERV.10

OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038Or

Issue P/O: 4477 LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

CD 07/08/29 ①

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage

Ensure copy of NDT results attached to work order.

LC 7/8/30

19.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D206-667-103

End 10/09/04

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1 Prime inside and outside crosstube as per QSI 005 4.2

2 Paint outside crosstube with White Imron as per QSI 005 4.2

ml 07 09 01

①

21.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Wrap in plastic bag to protect from scratches

FT 07 - 09 - 04

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2138 f(s)/Unit Total : 1.2138 f(s)

Pick:

Qty Part number Description Batch

2 D2856-400(Cut to 6.94") Abrasion Strip

32020

ml 07 09 02

23.0

D2873043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-043 Nut Plate

32802

FT 07 - 08 - 30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 5/2/2007 3:45:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 32141

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-045

Nut Plate

32777

BT 07-08-30

25.0

D28911

Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2891-1

Support

26715

ml 07 09 02

26.0

MS20601AD4W8

RIVET



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part number Description Batch

14 MS20601AD4W8 Rivet

102850

BT 07-08-30

27.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-20

Clamp

104902

ml 07 09 02

28.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



PTU

Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579. .Note: (2) Aft holes should be facing up.

2-Install supports and clamps as per Dwg D4206-667-143. Torque clamps to 80-100 in lb

3-Install nut plates as per Dwg D206-667-143. Touch-up rivet heads with Iron paint.




BT 07-09-04

BT 07-08-30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

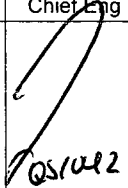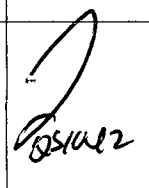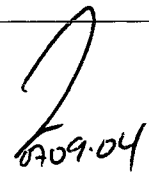NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07-09-04	28.0	Center support jigs were placed on the wing side, resulting in the supports abrasion strips being off center 3/16" 3/16". R.C. Employee error.		remove abrasion strips, and polish the tube. Apply 2 new abrasion strips B 32792 in the correct position.	BT 0709.04	See 07/09/05		

NOTE: Date & initial all entries

Date: Wednesday, 5/2/2007 3:45:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 32141

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 5/10/05

30.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

31.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M102850

CU

32.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: M104547

CU

33.0

AN57A

Bolt



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

10 AN5-7A

Bolt M104603

CU

34.0

AN530A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

4 AN5-30A

Bolt M19522

CU

35.0

AN960JD516

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

18 AN960JD516

Washer M104156

CU 7/8/05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 5/2/2007 3:45:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 32141

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

36.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

Er 07/02/05

37.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-667-103

Location: _____

PPP Rev: B

CB 7/9/05 (1)

38.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 07/09/05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 32141
Description: Crosstube Assembly (206L High Fwd)	Part Number: D206-667-143
Inspection Dwg: D206-667-143 Rev: B	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype


Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.244				
	1.982	+0.005/-0.000	1.986				
	2.019	+0.005/-0.000	2.023				
	2.058	+0.005/-0.000	2.062				
	2.097	+0.005/-0.000	2.101				
	2.136	+0.005/-0.000	2.141				
	2.176	+0.005/-0.000	2.181				
	2.201	+0.005/-0.000	2.205				
	0.125	+/-0.010	.125				
	0.400 x 30°	+/-0.010	.400				
	R0.063	+/-0.010	.063				
	R0.500	+/-0.010	.500				
	4.438	+/-0.030	4.431				
	104.98	+/-0.020	104.95				
	2.240	+0.005/-0.000	2.244				
SIDE B	1.982	+0.005/-0.000	1.986				
	2.019	+0.005/-0.000	2.023				
	2.058	+0.005/-0.000	2.062				
	2.097	+0.005/-0.000	2.101				
	2.136	+0.005/-0.000	2.141				
	2.176	+0.005/-0.000	2.181				
	2.201	+0.005/-0.000	2.205				
	0.125	+/-0.010	.125				
	0.400 x 30°	+/-0.010	.400				
	R0.063	+/-0.010	.063				
	R0.500	+/-0.010	.500				
	4.438	+/-0.030	4.431				
	104.98	+/-0.020	104.95				
	2.240	+0.005/-0.000	2.244				
	1.982	+0.005/-0.000	1.986				

Measured by: JRS	Audited by: EW	Prototype Approval: N/A
Date: 07/05/15	Date: 07/07/26	Date: N/A

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	

DART AEROSPACE LTD		Work Order:	32141
Description: Crosstube High Fwd (206L)		Part Number:	D206-667-103
Inspection Dwg: D206-667-143 Rev: B		Page 1 of 1	

Required Dimension	Min	Max
Height	23.46	23.58
1/2 Span	41.86	41.98
Angle	54	56
Total Span	83.72	83.96

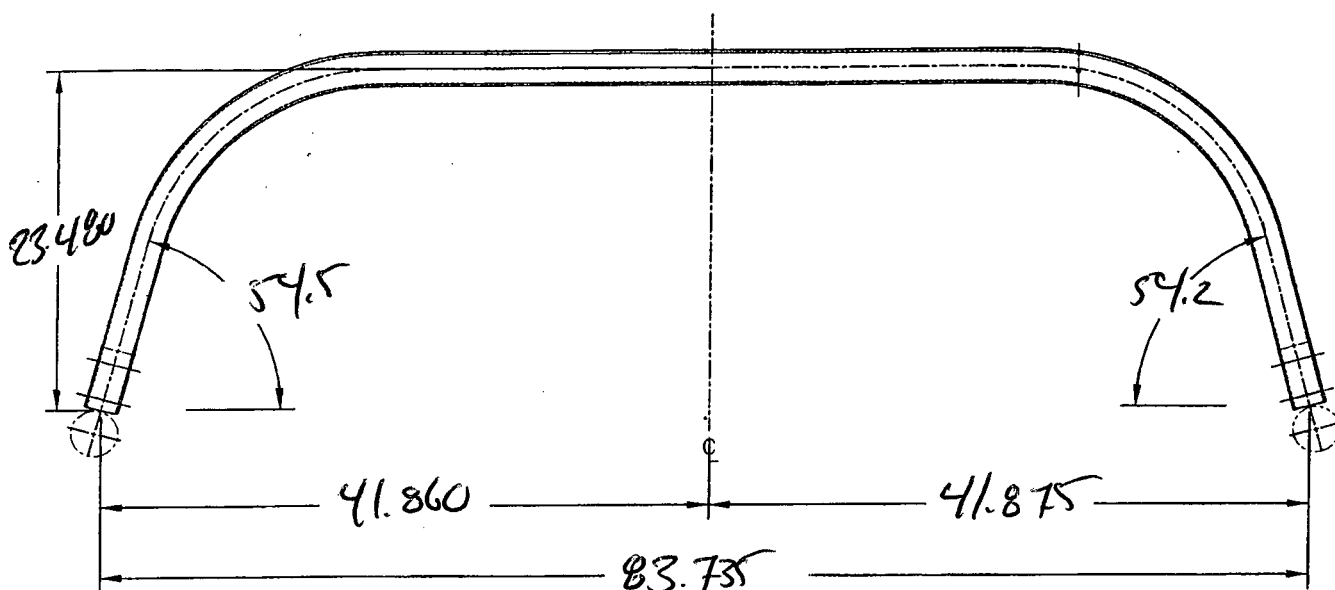

Comments

QC15 Inspection	Dr
Date	2/02/21

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>



DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH FWD) NTS	
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED
05-07-26

UNDER REVIEW

05-08-10 PH

re-draw detail F
PH

07.05.02

Qty	Part Number	Description
X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
1	D6002-115	CROSSTUBE
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
4	MS21920-20	CLAMP



GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 104.98±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX-241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32141

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

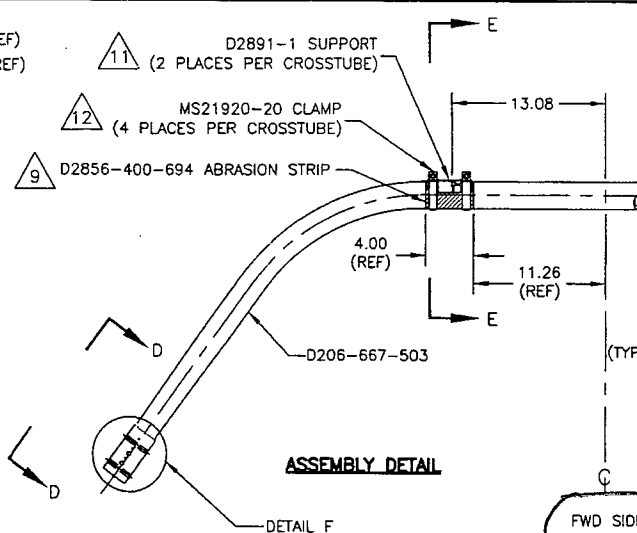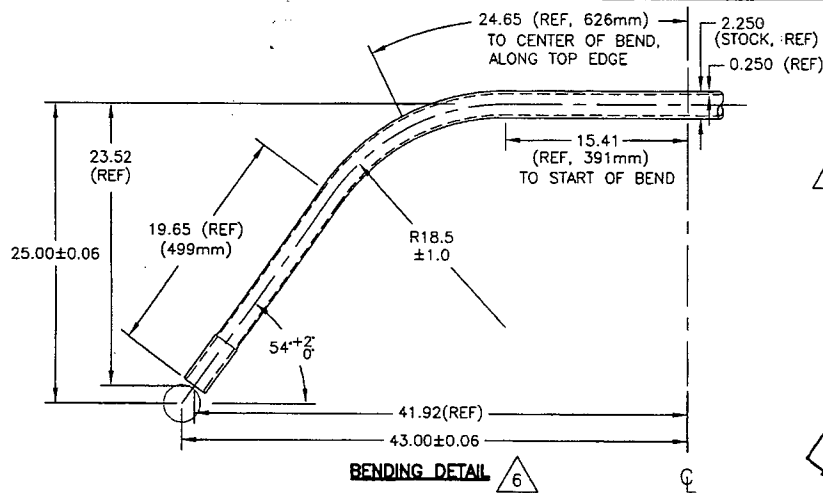

(B) $\phi 0.323^{+0.005}_{-0.000}$
(TYP 5 PLACES PER CUFF)
HOLE TO BE ALIGNED WITHIN ± 0.001
OF HOLE ON OTHER SIDE OF CUFF



PILOT $\phi 0.128$
C'SINK $\phi 0.225 \times 100'$
(TYP 7 PLACES PER CUFF)

FWD SIDE ONLY


DETAIL F
SCALE 2:5

FWD SIDE ONLY

PH 02.05.22
UNDER REVIEW
DE-0010 PH
re-draw detail F

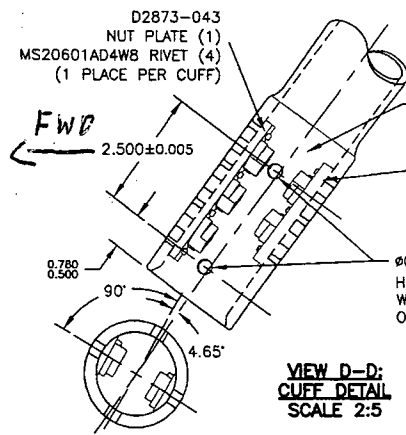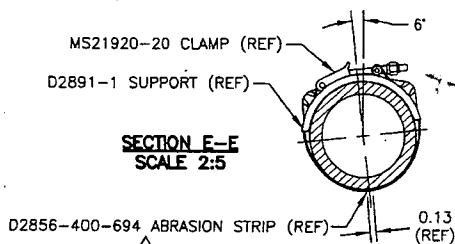

D2873-045
NUT PLATE (1)
MS20601AD4W8 RIVET (3)
(1 PLACE PER CUFF)

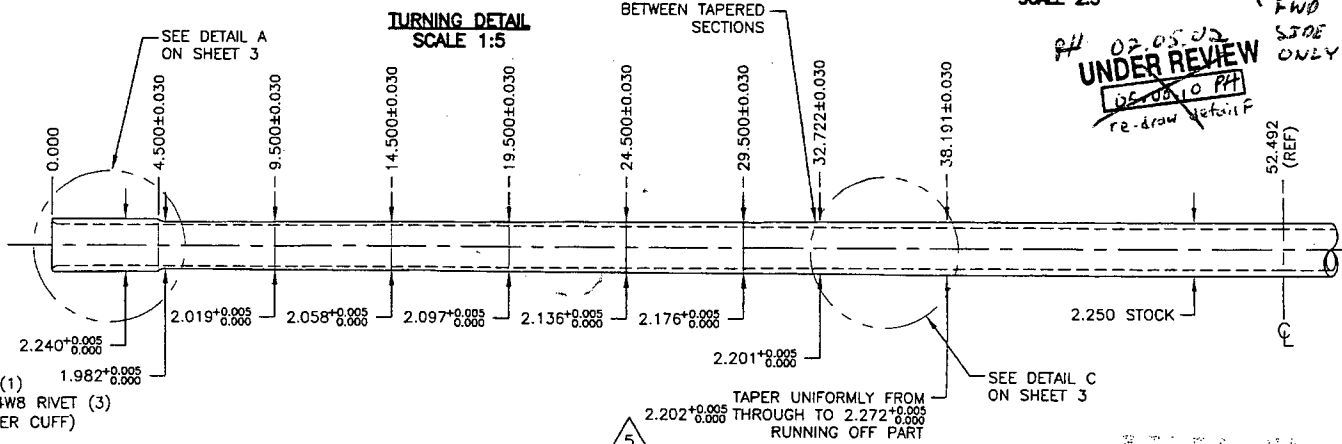


SEE DETAIL C
ON SHEET 3

NO. 32141
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY


COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. MARKHAM, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	PH DS	APPROVED	PH DS	DRAWING NO.	D206-667-143
		DATE	05.07.26	TITLE		CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE 1:10

05.07.26

DETAIL A: CROSSTUBE CUFF

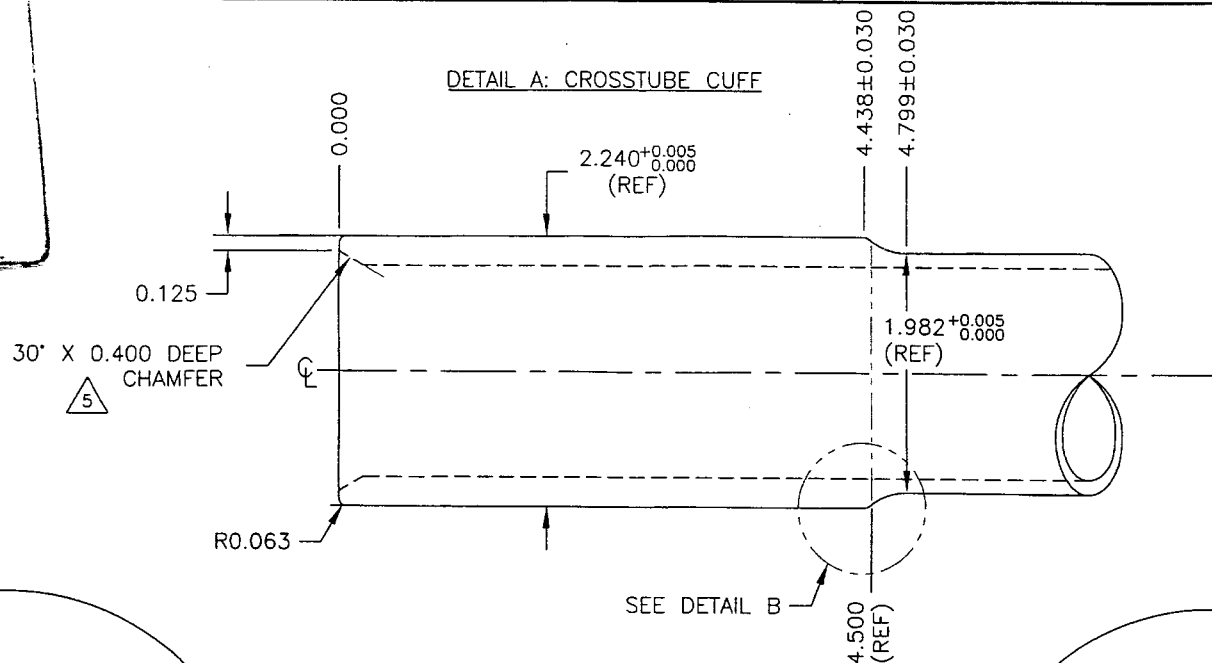


UNDER REVIEW
~~06.07.02 PH~~
~~PH 07.05.02~~

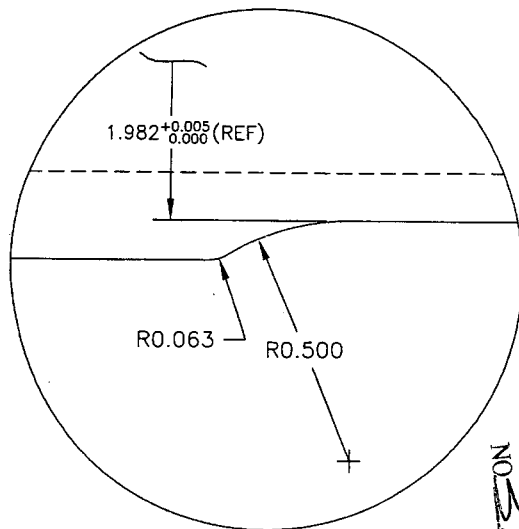

DETAIL B: CUFF
 TRANSITION
 SCALE 4:1

DETAIL C:
 TAPER RUN-OFF
 NOT TO SCALE

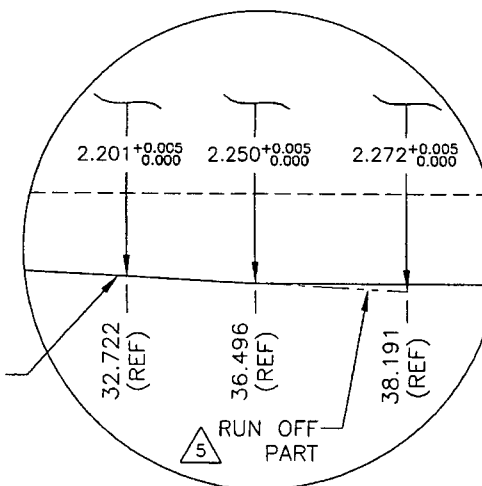



SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO 32147

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
 AND IS SUPPLIED ON THE EXPRESS CONDITION
 THAT IT IS NOT TO BE USED FOR ANY PURPOSE
 OR COPIED OR COMMUNICATED TO ANY OTHER
 PERSON WITHOUT WRITTEN PERMISSION FROM
 DART AEROSPACE LTD.

DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
CHECKED	PH	APPROVED	PH	DRAWING NO.	REV. B
DATE	05.07.26			D206-667-143	SHEET 3 OF 3
				TITLE	SCALE
				CROSSTUBE ASS'Y (206L HIGH FWD)	1:1

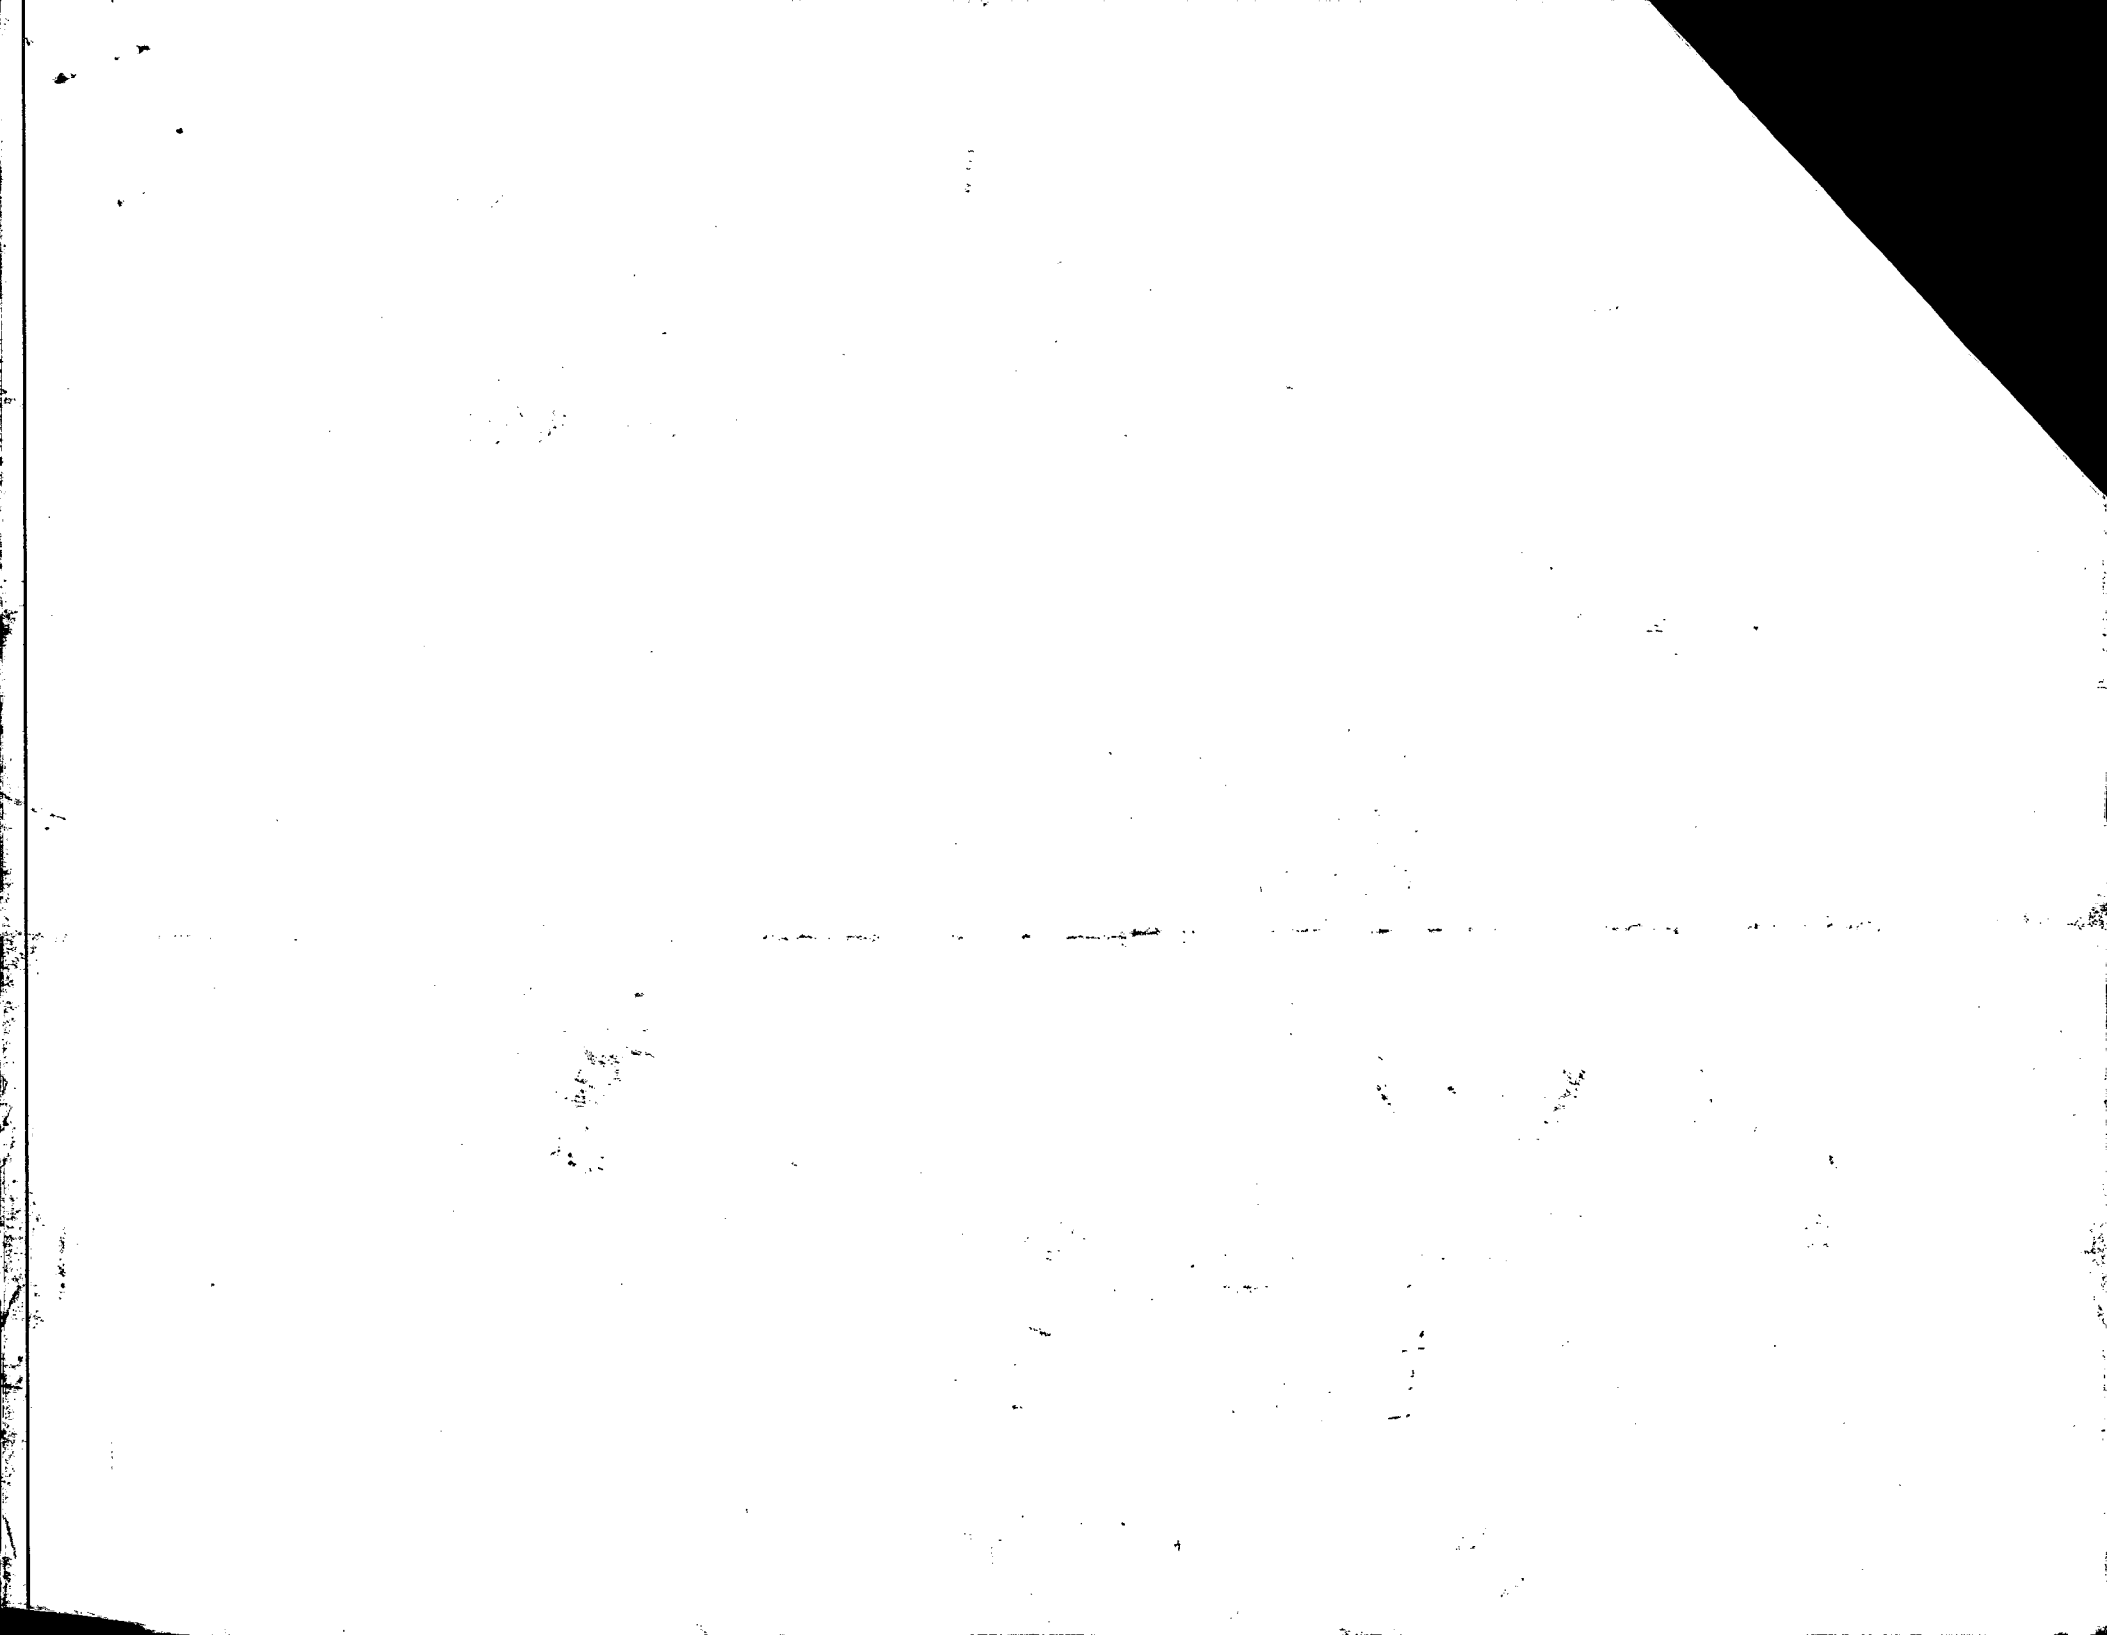

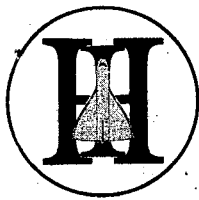

HeathAir

INTERNATIONAL (1991) INC.

681 Ave. Lepine, Dorval, Québec H9P 1G3
Tél.: (514) 636-1000 • Fax: (514) 636-0031

W.O. N° 37260

A.M.O. Number: 46/90

NON-DESTRUCTIVE TESTING REPORT

AIRCRAFT / COMPONENT INFORMATION

REGISTRATION:

MODEL/TYPE:

SERIAL NUMBER:

TOTAL HR/LDG:

OPERATED BY:

BASED AT:

INSPECTION REQUIREMENTS

Carry out FPI of (6) cross tubes (external surface) as per ASTM E-1417-05 and the Dart QSI 038, Section 4.1.1 (on file at client) - parts delivered to HeathAir.

Qty (3) P/N D206-667-103 S/N's B32141, B33683 and B33684.

Qty (2) P/N D206-667-203 S/N's B33688 and B33161.

Qty (1) P/N D206-667-103BL S/N B33155.

☐ RADIOGRAPHY

☐ ULTRASONIC

☒ PENETRANT

☐ MAGNETIC PARTICLE

☐ EDDY CURRENT

INSPECTION REPORT

Fluorescent penetrant inspection was performed in accordance with the above requirements on (6) cross tubes.

Note: A Level 3 penetrant was substituted for the requested Level 2 (3 is more sensitive)
Ardrox 970P25E Batch #04B503.

(6) cross tubes inspected. (6) PASSED / (0) FAILED.

THE MAINTENANCE DESCRIBED ABOVE HAS BEEN PERFORMED IN ACCORDANCE WITH
THE APPLICABLE STANDARDS OF AIRWORTHINESS

INSPECTED BY:

[Signature]
DL HEATH

DATE August 29, 2007

INSPECTION
STAMP(S)

NIR

CUSTOMER INFORMATION

CUSTOMER: Dart Aerospace

P.O. NUMBER PO 00004477

ADDRESS:

CONTACT NAME: Linda Lacelle

INVOICE NO.

TOTAL \$

WHITE COPY - INSPECTION FILE • YELLOW COPY - CUSTOMER • PINK COPY - ACCOUNTANT

